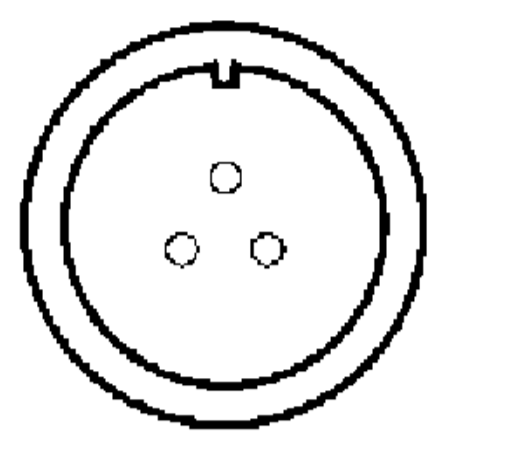
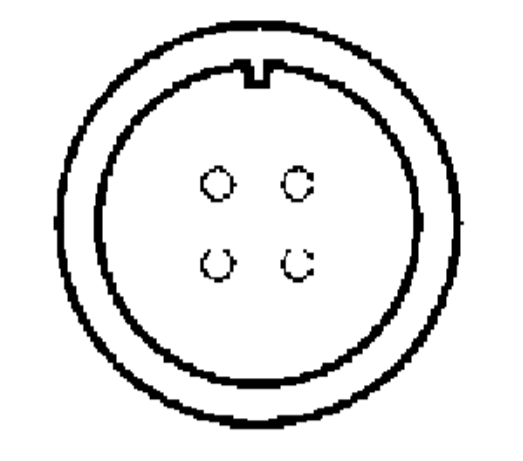
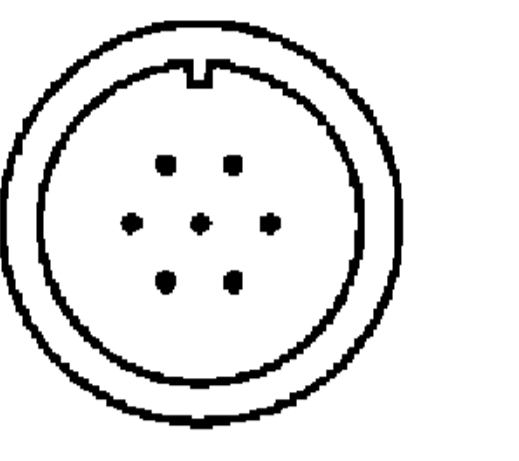
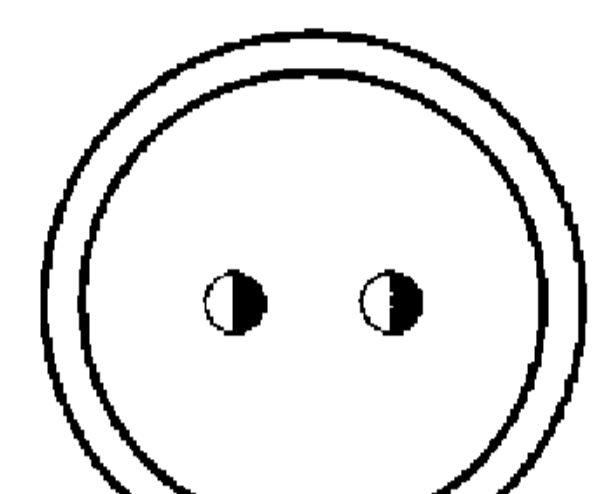
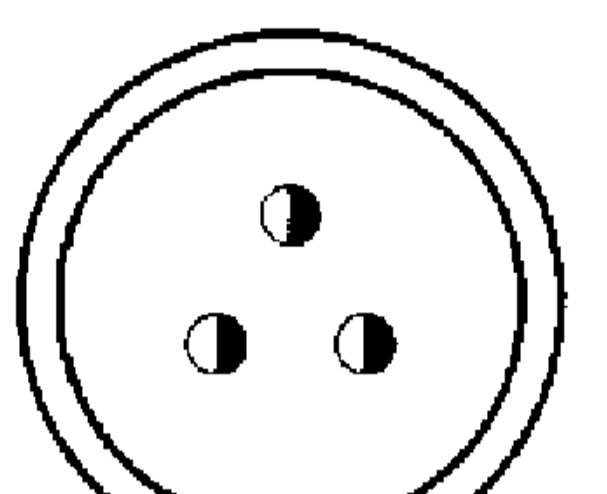
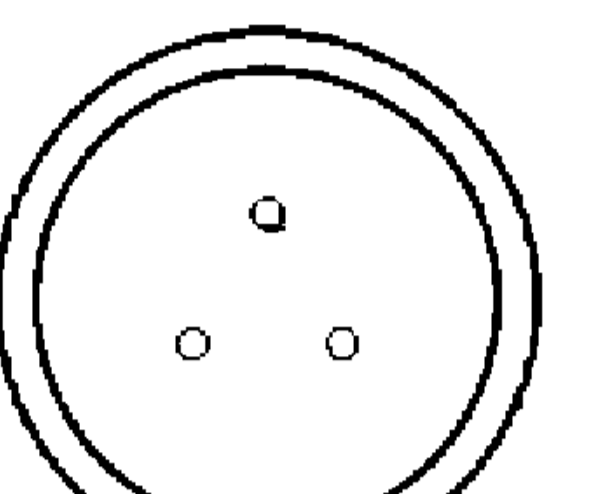
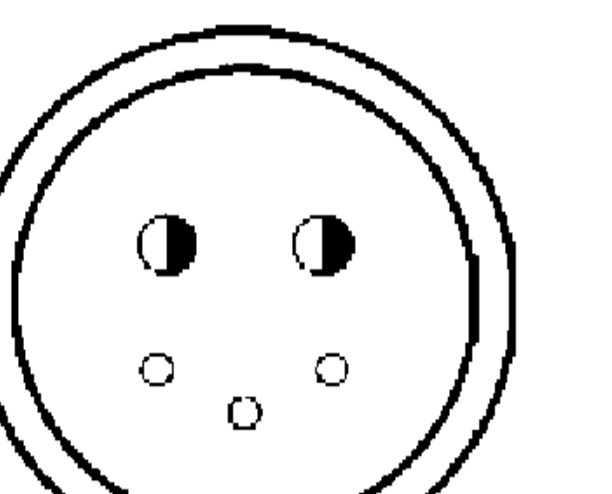
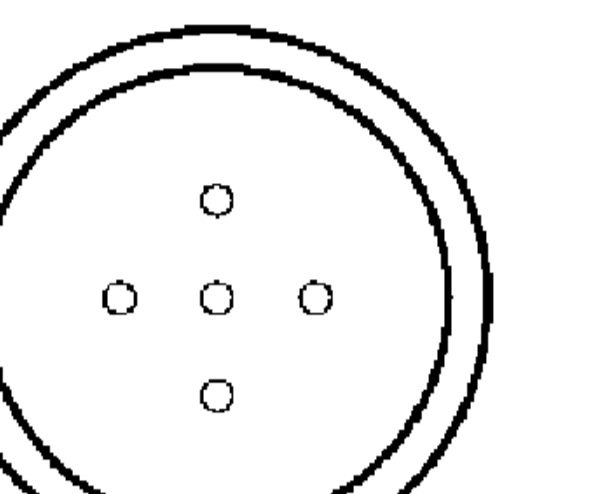
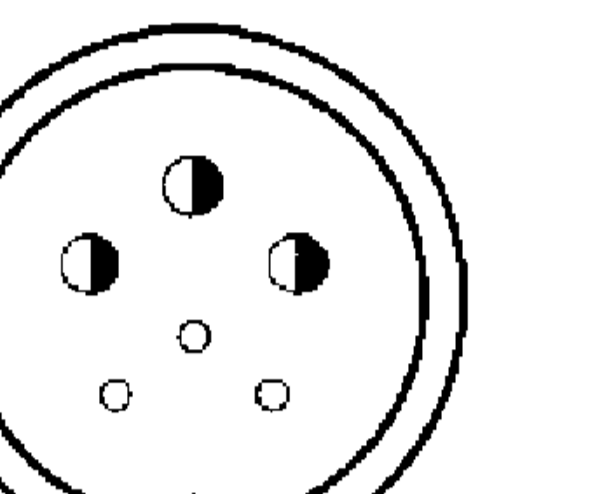
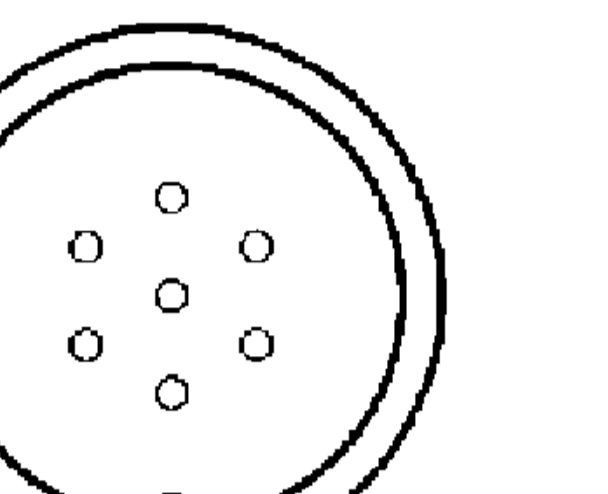
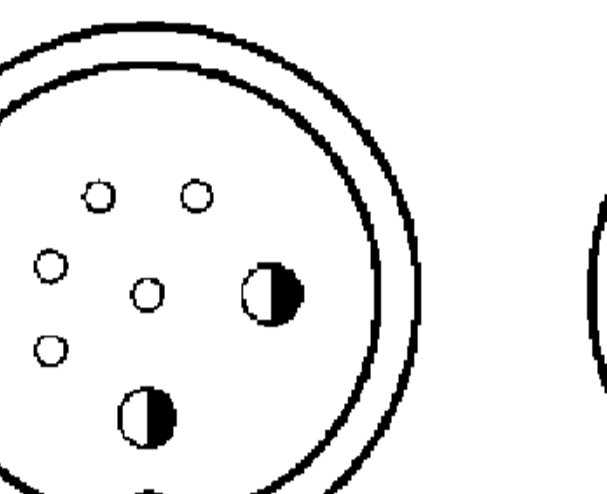
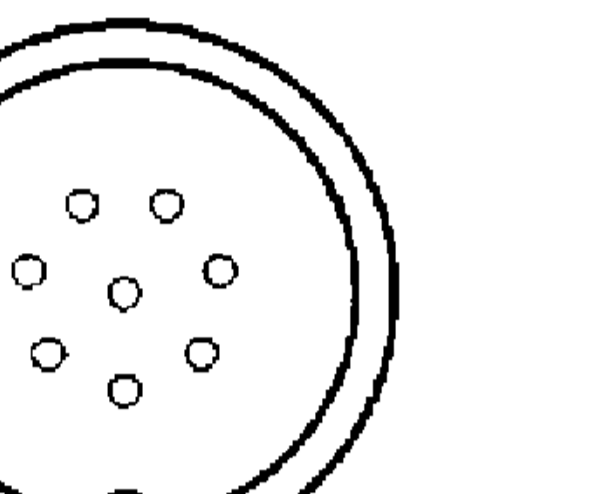
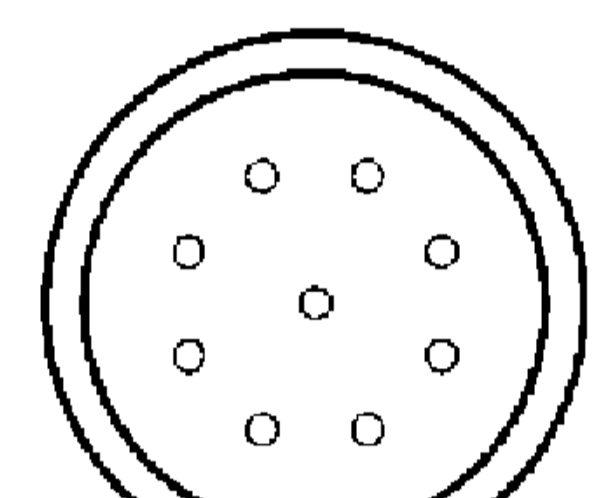
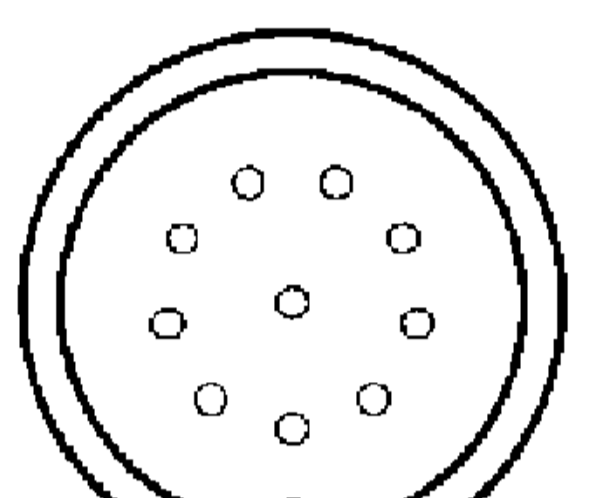
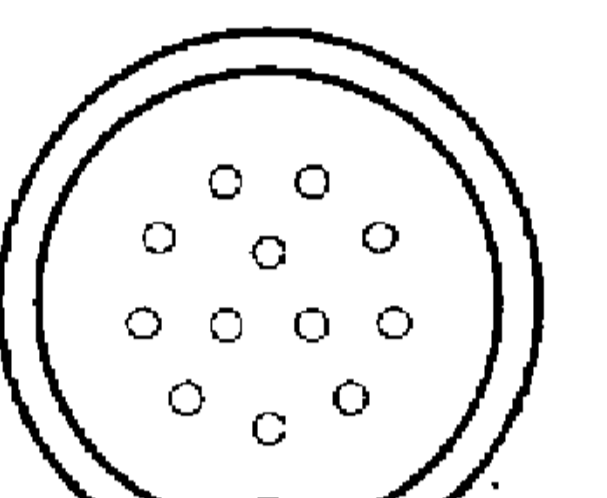
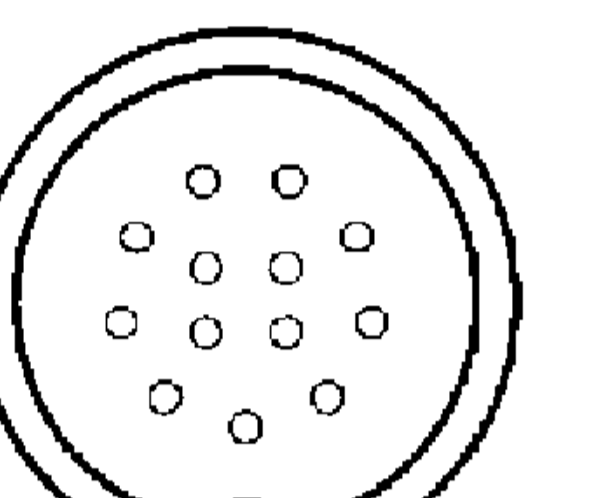
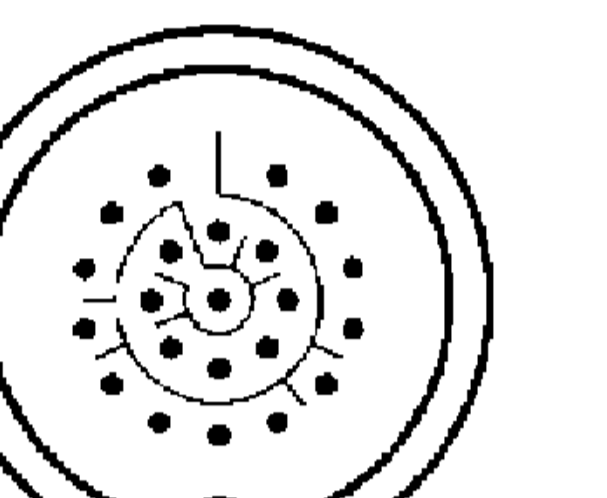
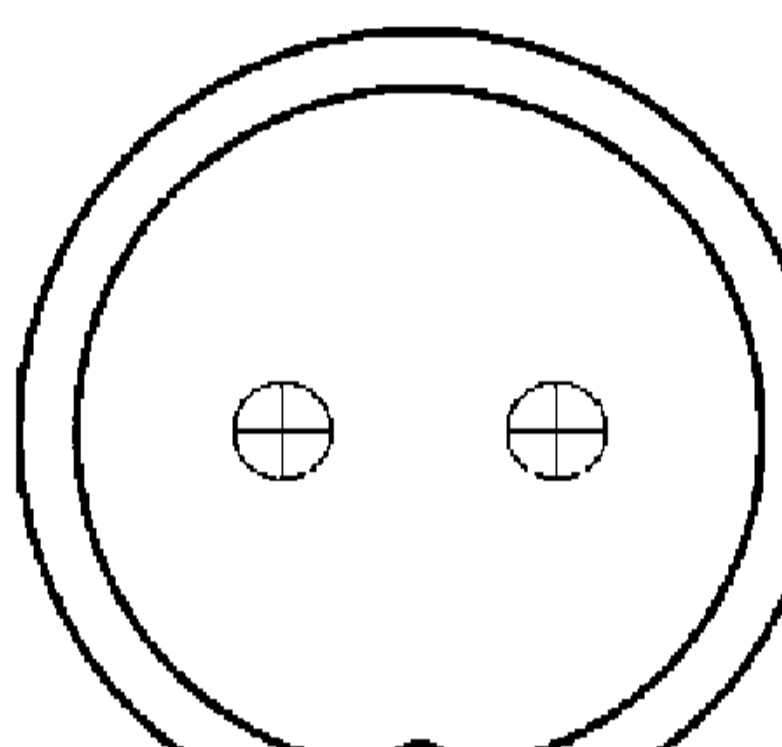
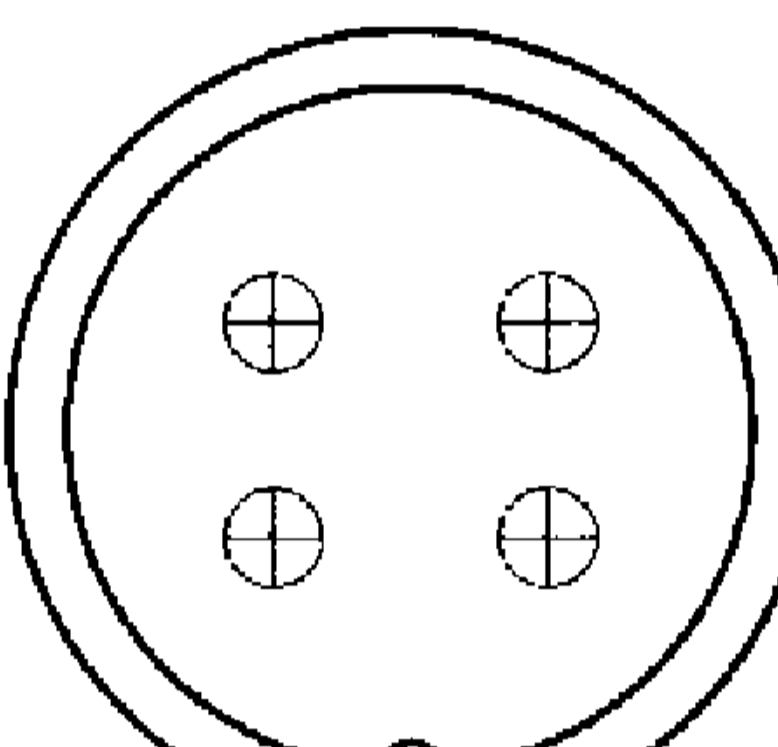
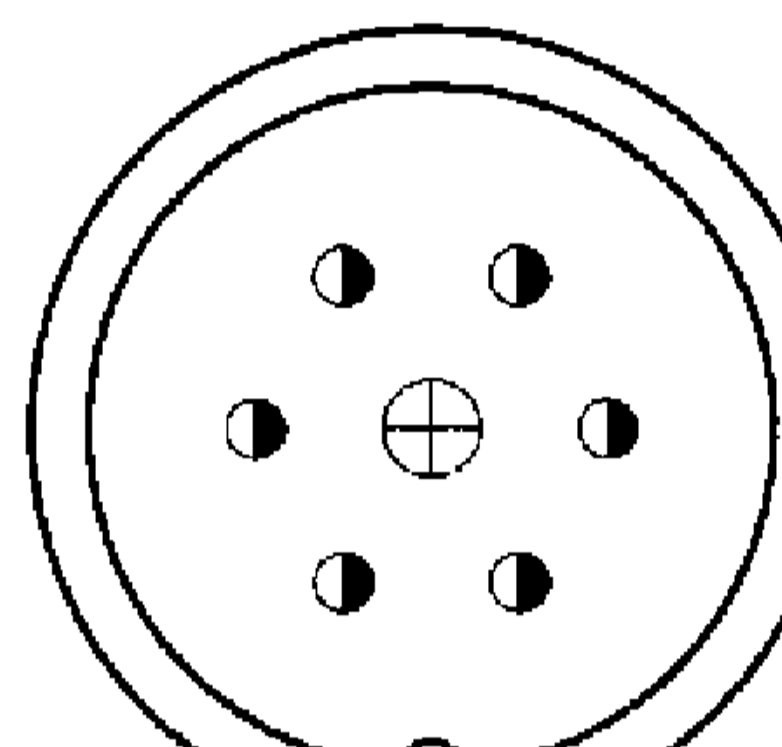
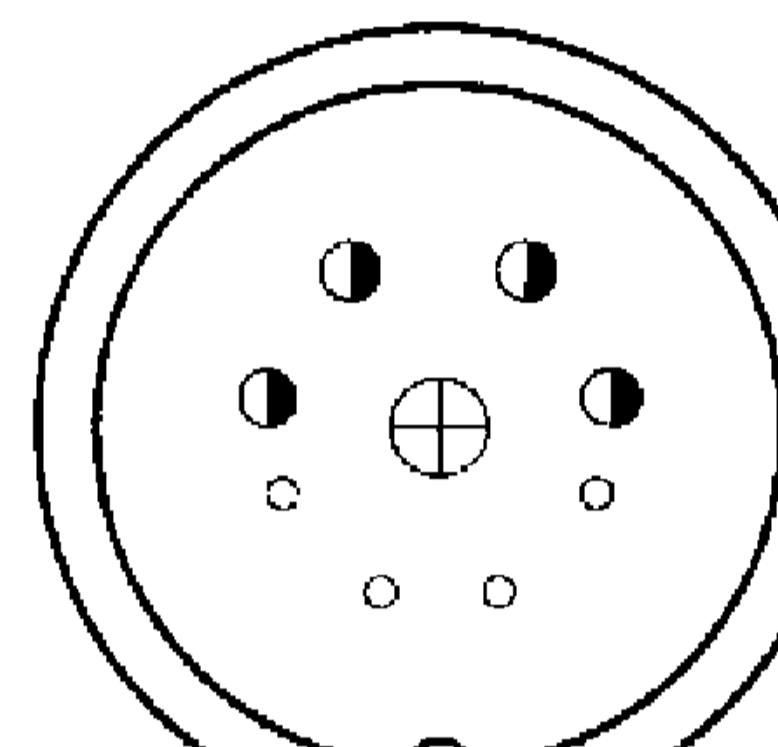
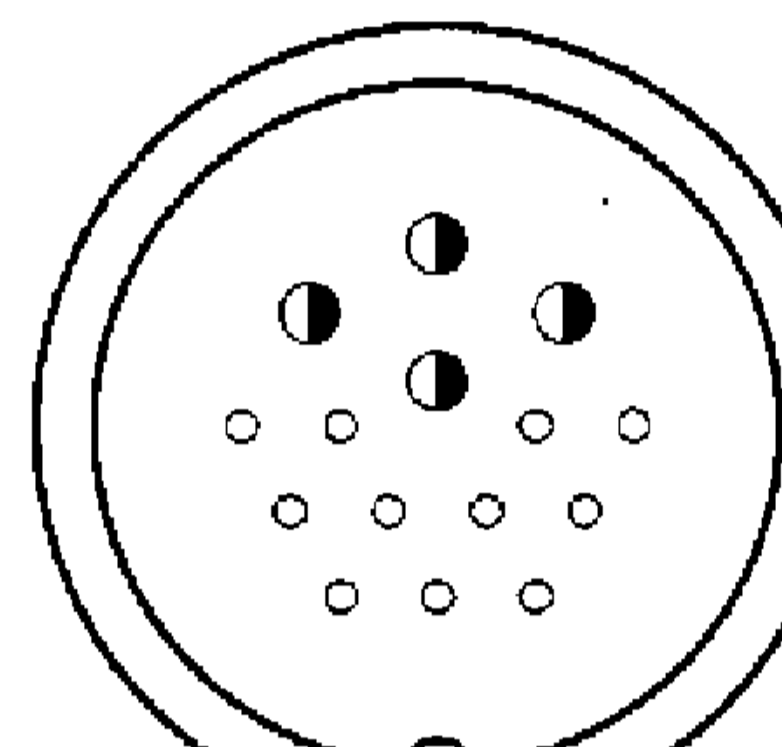
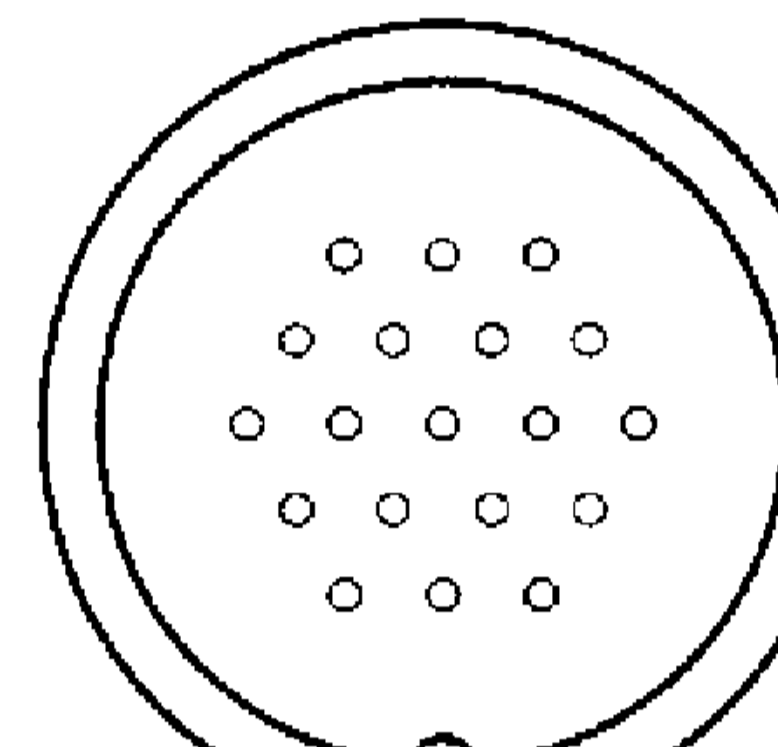
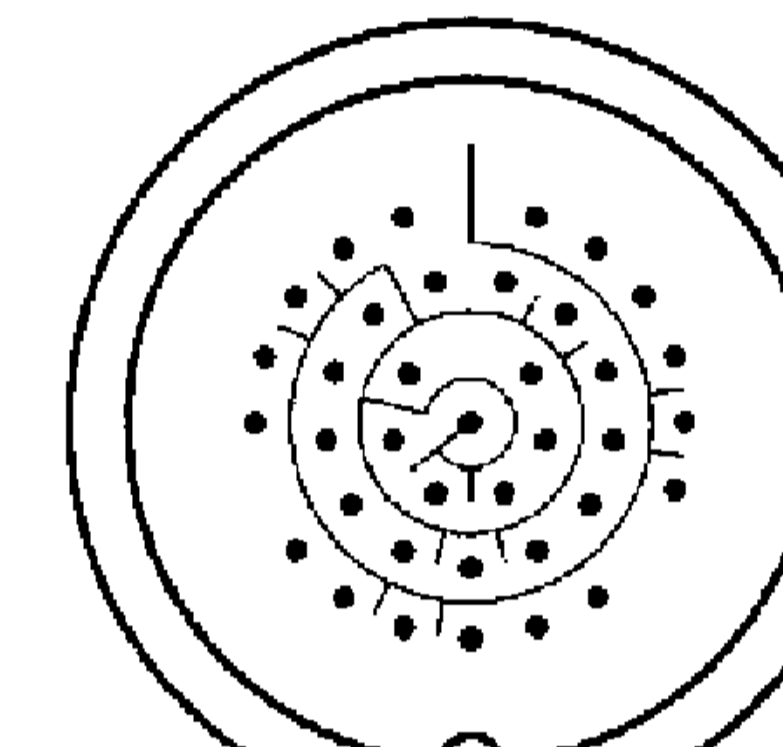
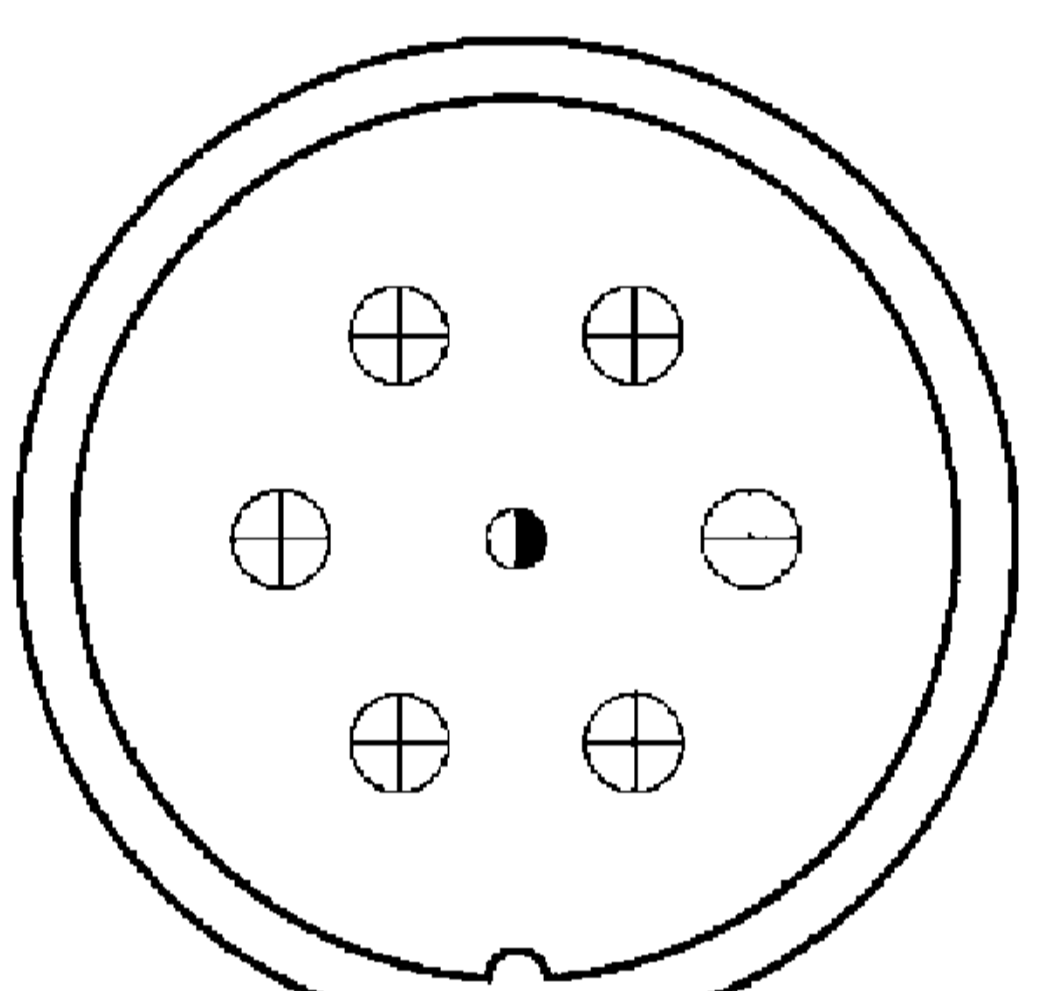
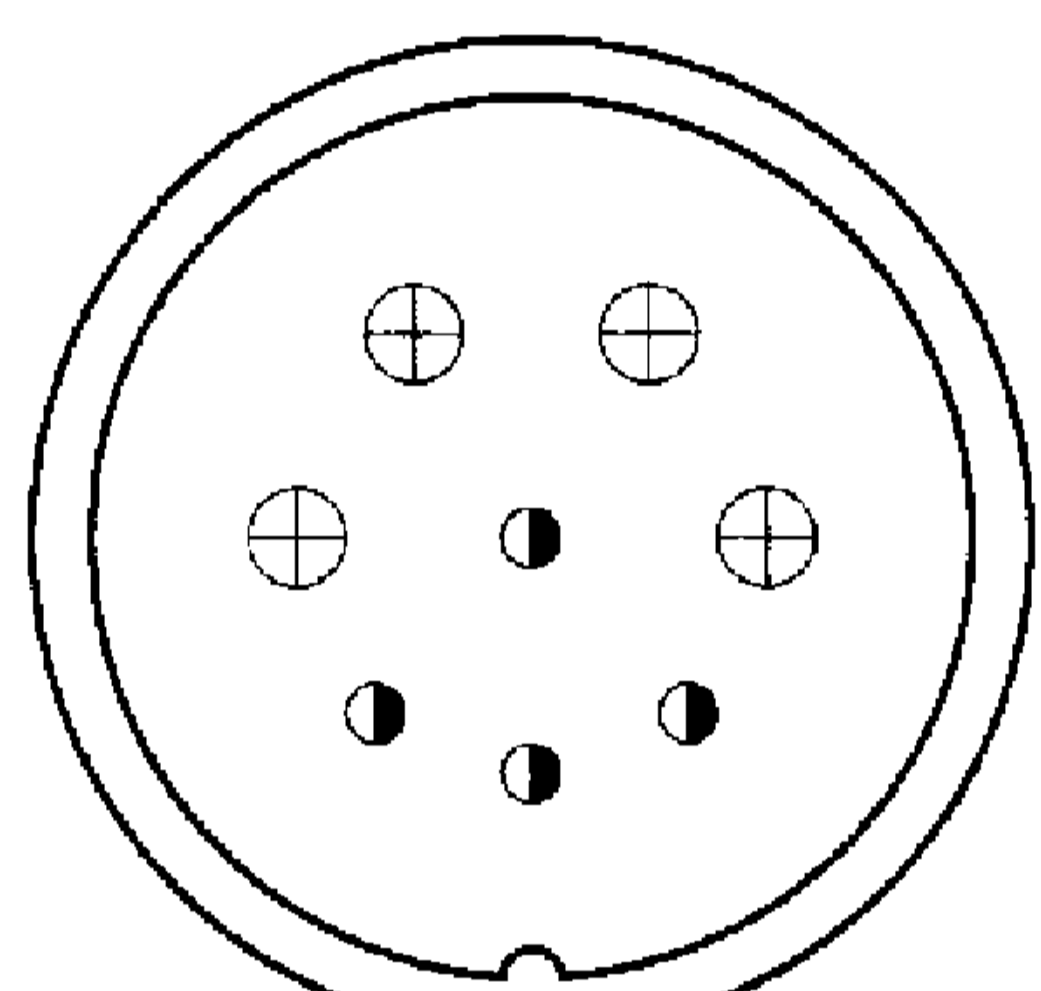
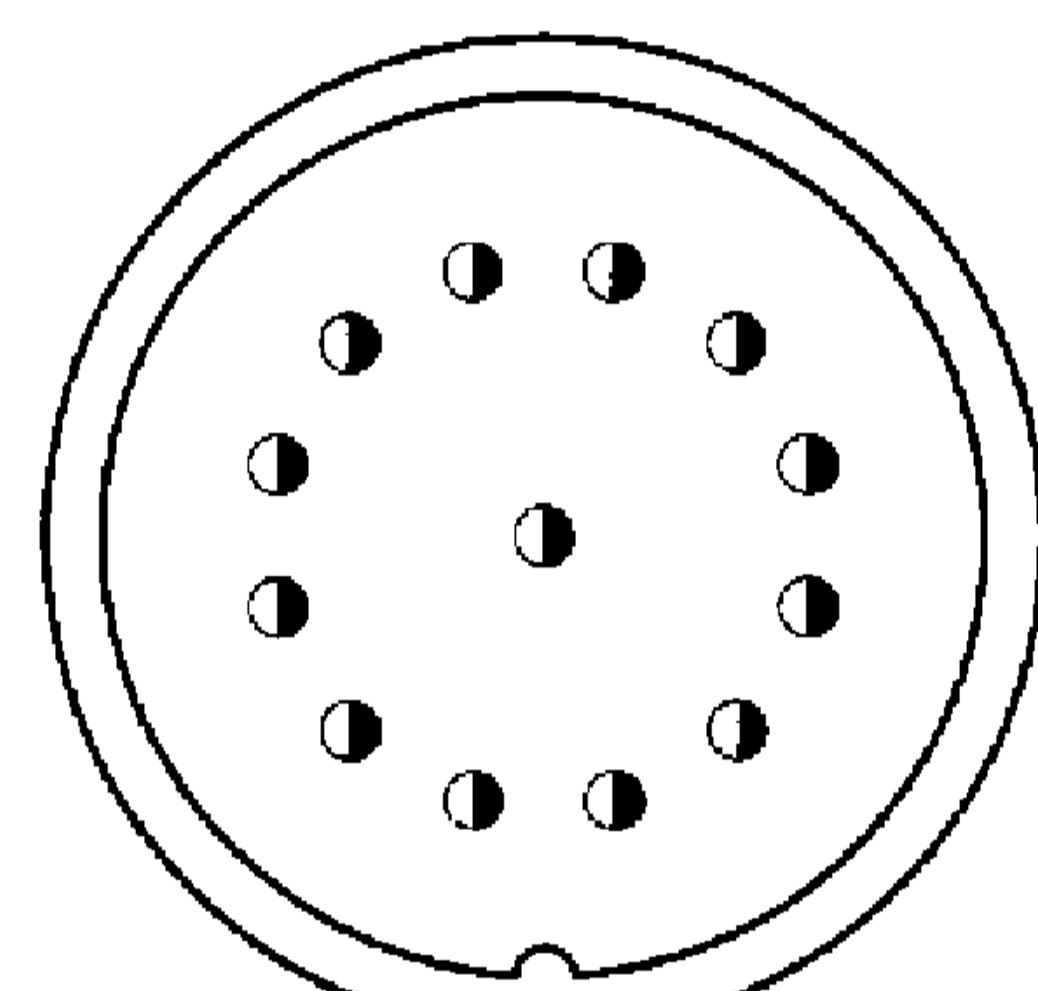
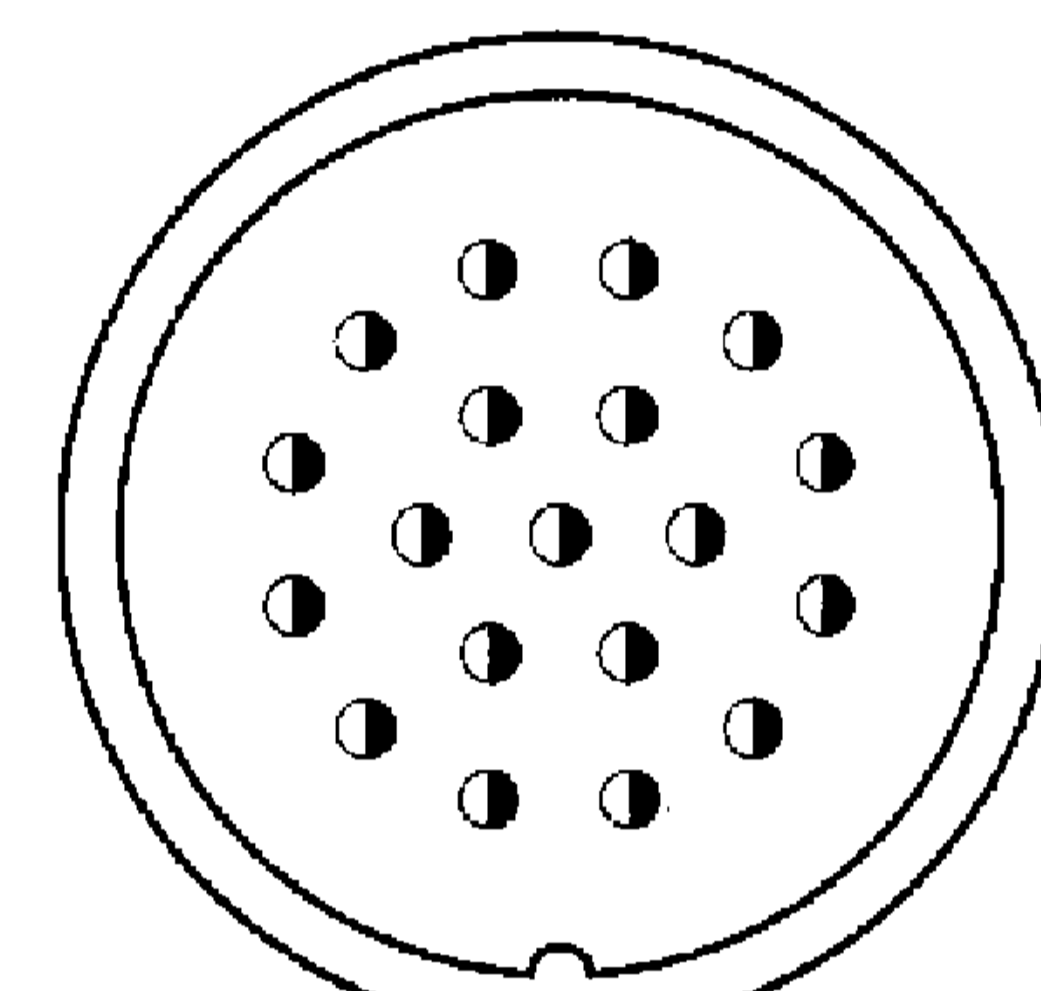
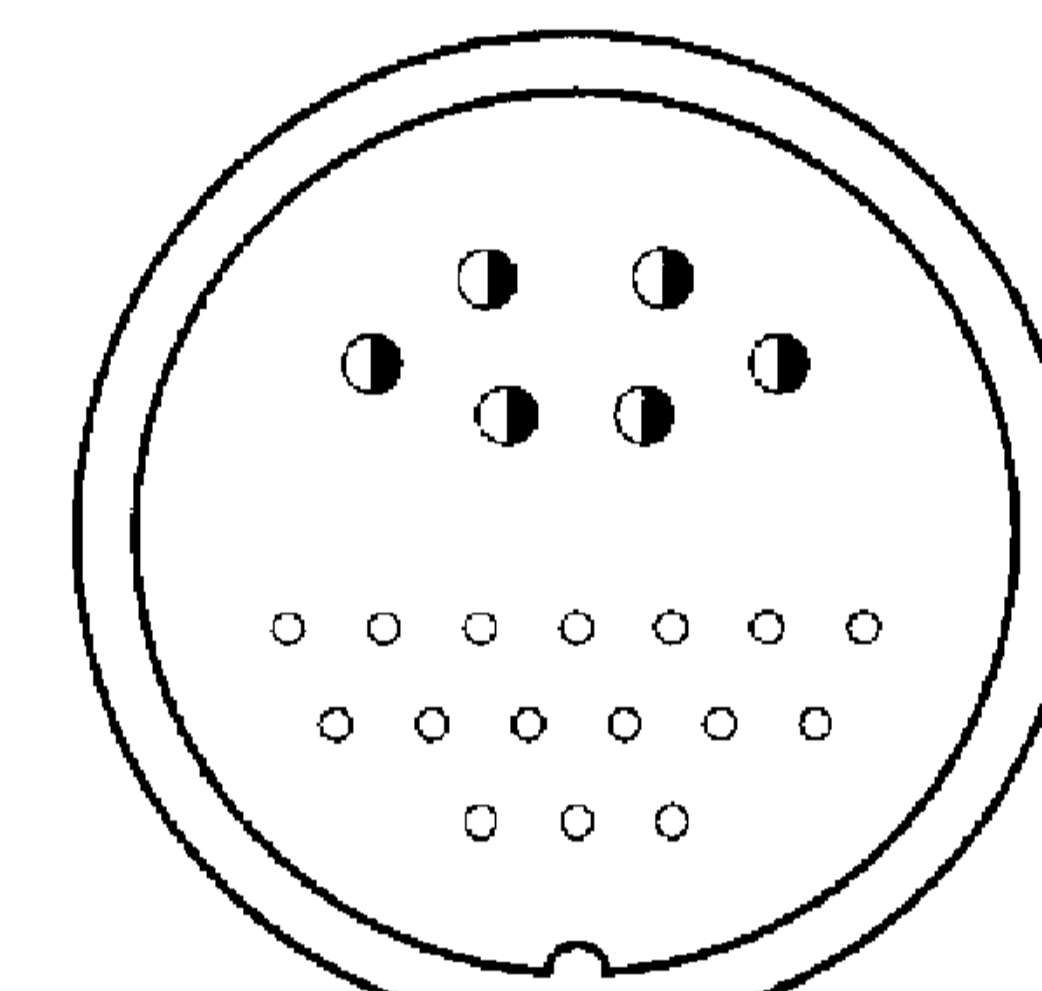
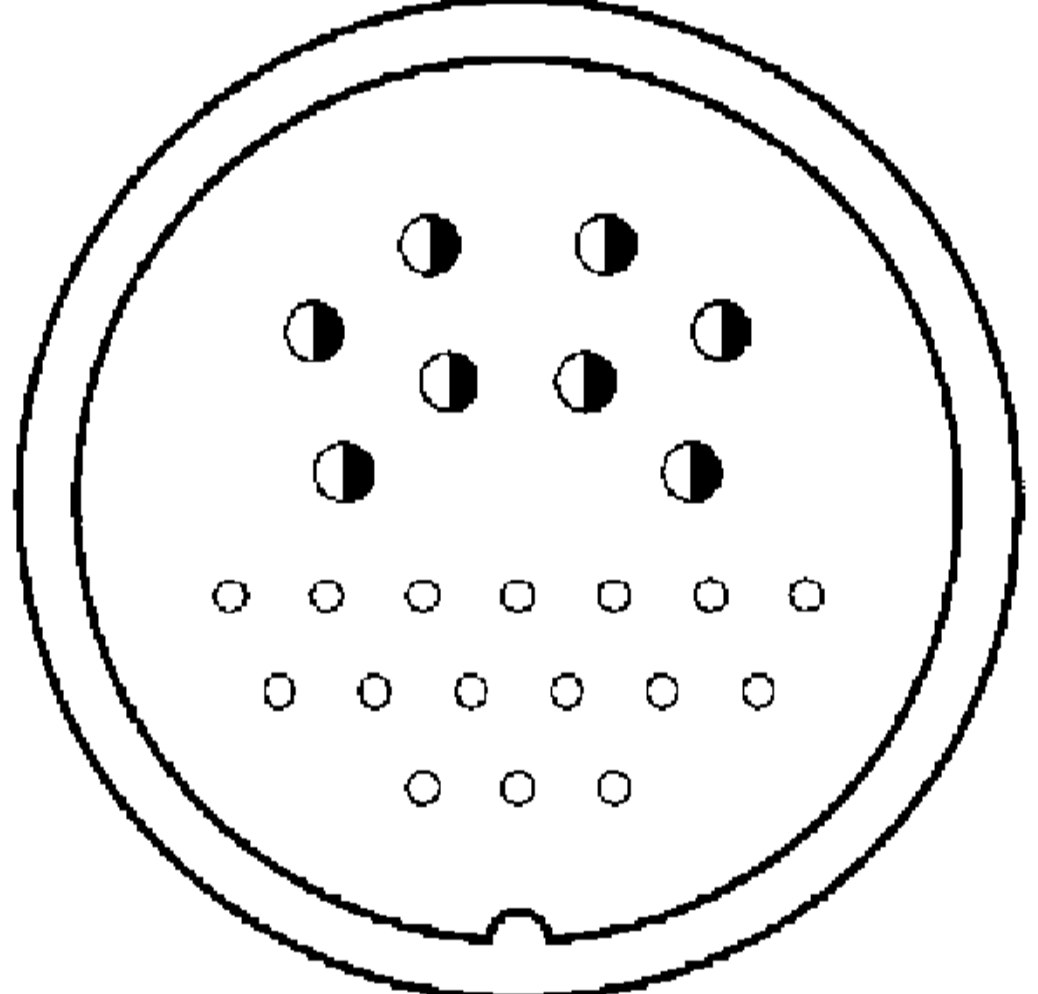
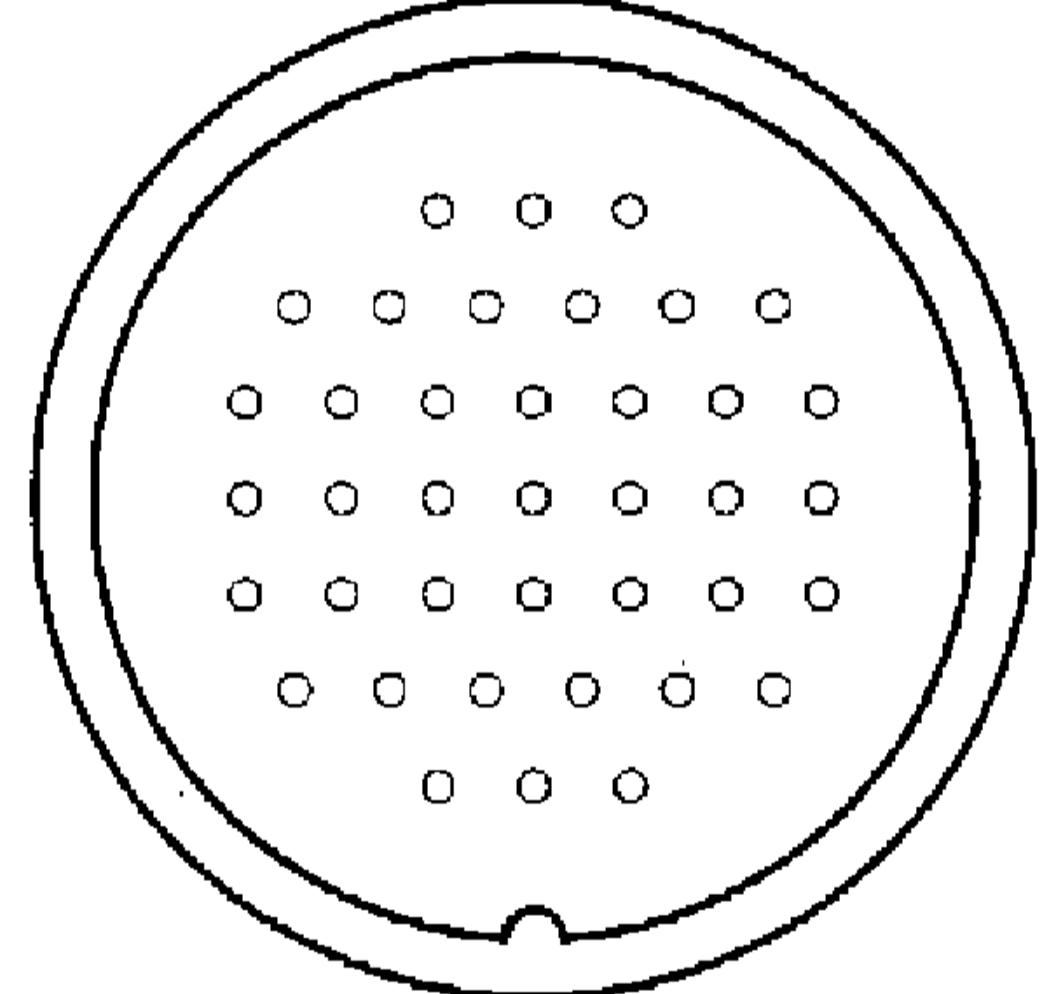
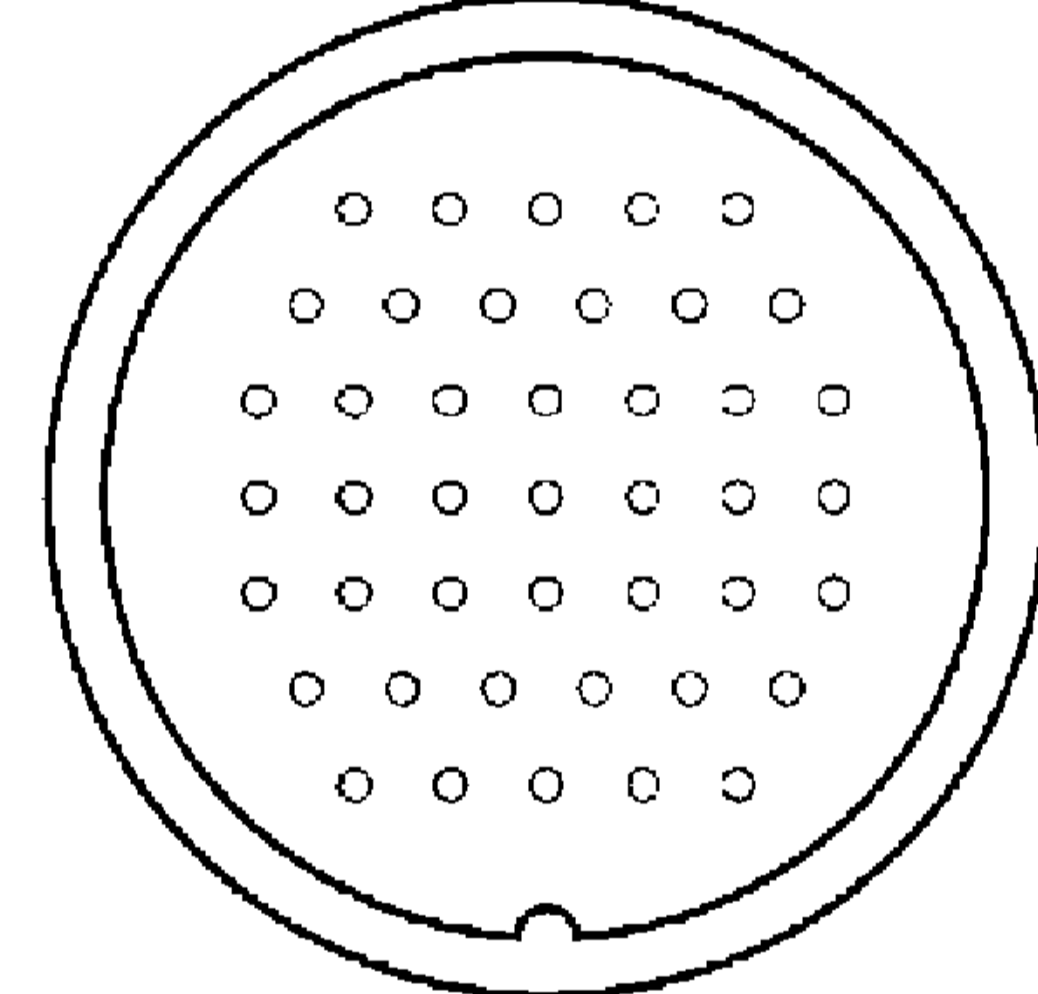
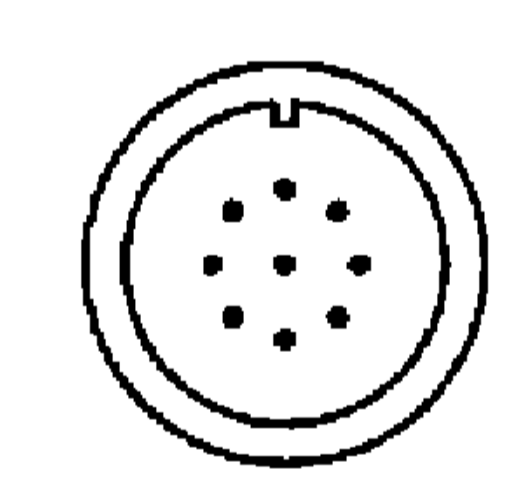
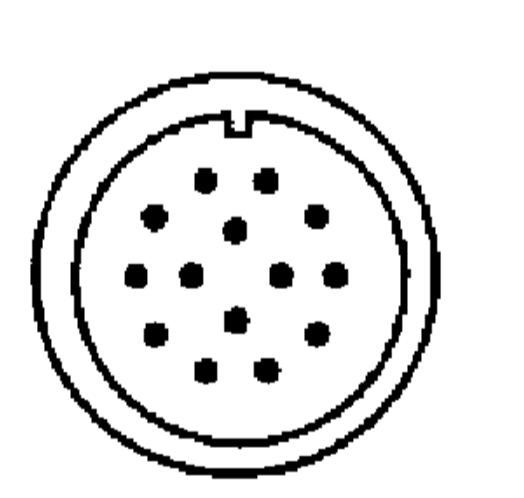
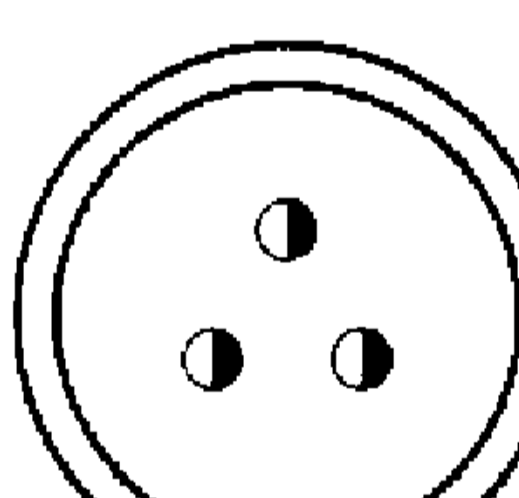
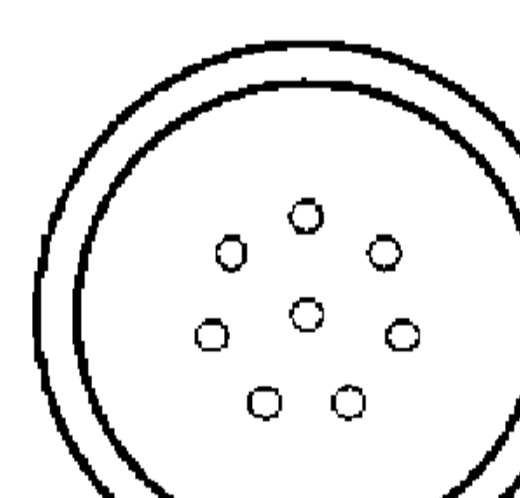
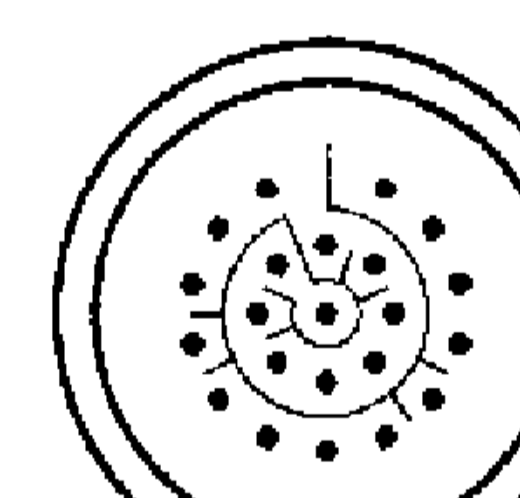
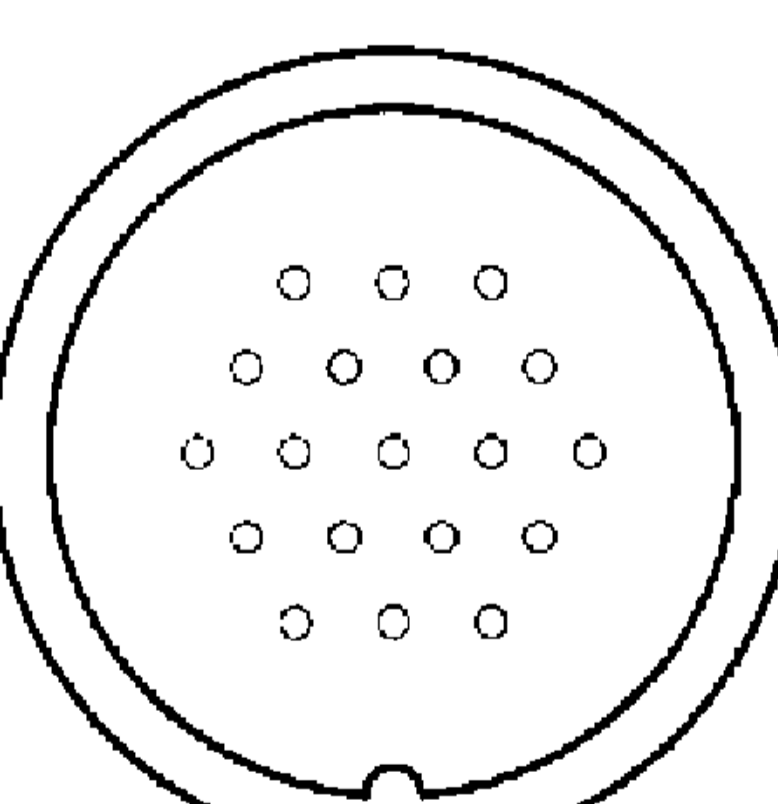
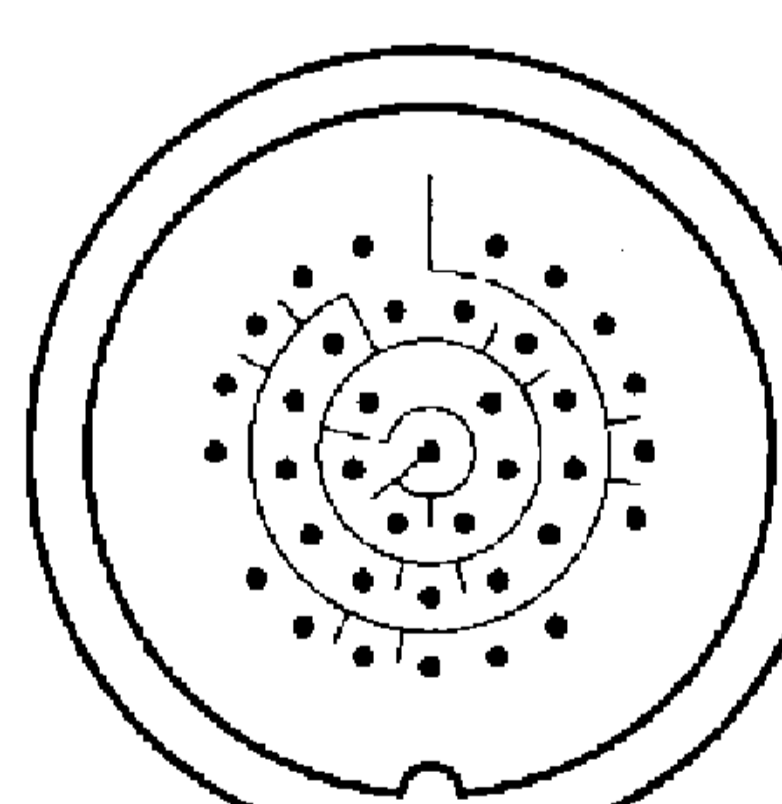
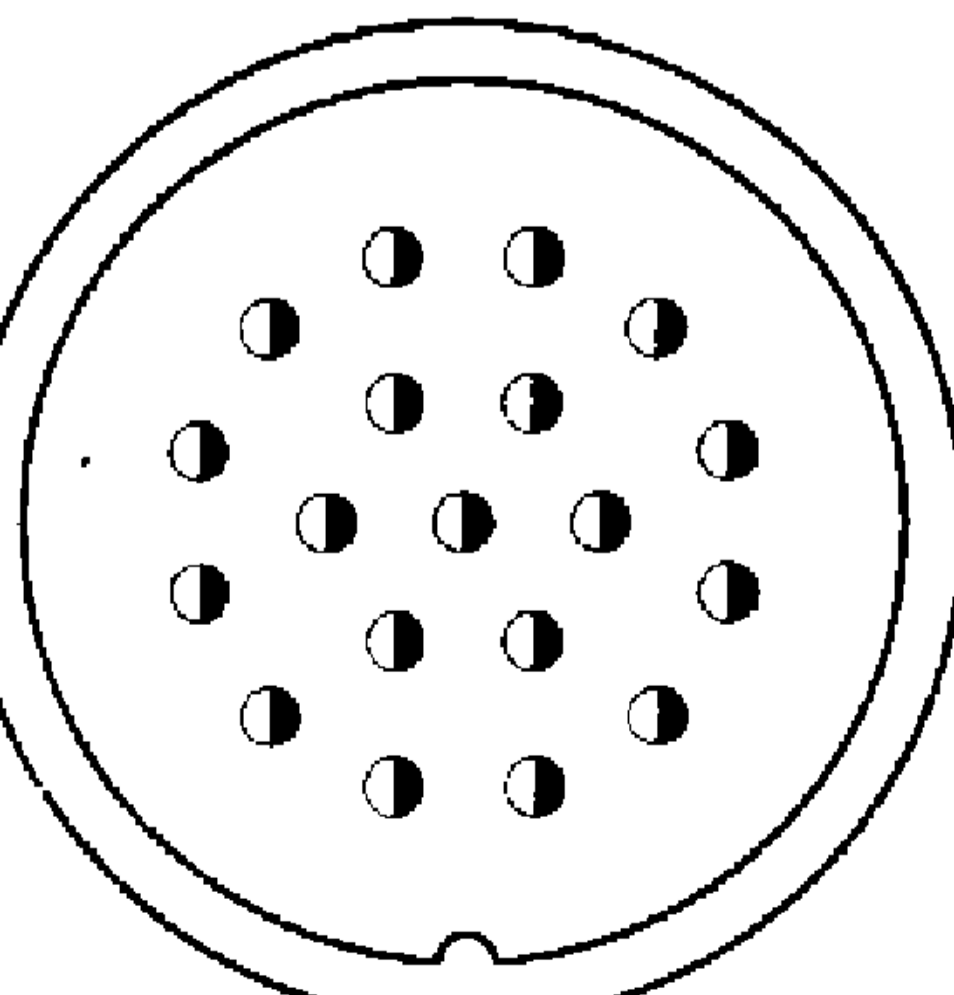
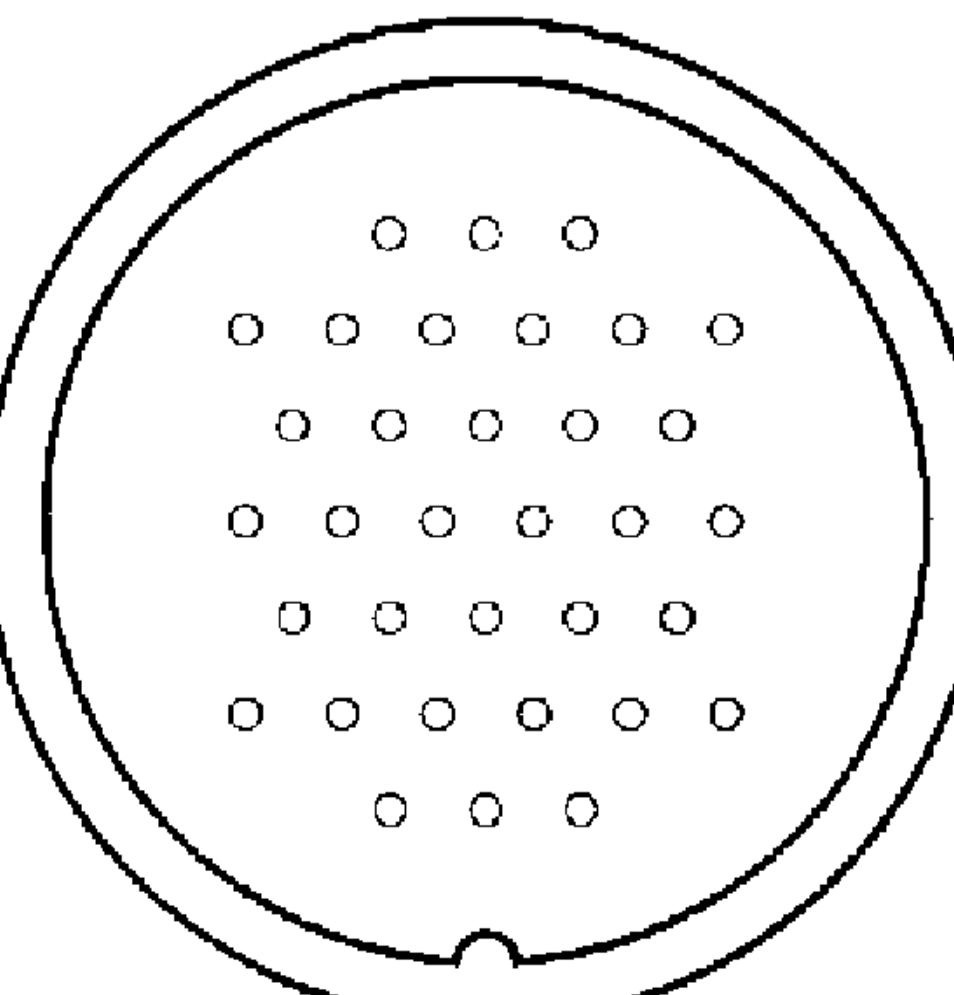


Distribución de contactos más usuales

Contactos a soldar

T-10	  
T-20	        
	    
T-30	      
T-40	    
	  

Disposicion aislantes a engastar

T-10	 
T-20	  
T-30	 
T-40	 

Contactos y utiles a engastar

Aislante	Sección de cable	Referencia de contacto		Utiles de engastado				
		Macho	Hembra	Tenaza fija	Tenaza regulable	Torreta posicionado	Insertor	Extractor
19CD	AWG 20-24	PX C-12	SX C-10	2613-1	AFM8	K-613	701	702/3
	AWG 26-28	PX C-12	SX C-10	2613-2				
28CD	0.75 mm ²	PX C-115	SX C-114	—	M-309	SH-480	DAK-126-16	DRK-289
319CD	1.5 mm ²	PX C-89	SX C-88					
434CD	2.5 mm ²	PX C-91	SX C-90					
222CD	AWG 20-28	PX C-615	SX C-614	—	AF8	TH 598	701	702/3
337CD	AWG 20-28	PX C-148	SX C-149	—	AF8	TH 598	T3-293	702/3
23CD	1.5 mm ²	PX C-86	SX C-85	—	M-309	SH-480	DAK-290	120TC125
	2.5 mm ²	PX C-82	SX C-81					
419CD	4 mm ²	PX C-140	SX C-139					